R88D-KN□□□-ML2, R88D-KT□

Accurax G5 servo drive

Accurate motion control in a compact size servo drive family. MECHATROLINK-II motion bus and safety built-in.


- MECHATROLINK-II and Analog/ Pulse servo drive models
- Safety conforming ISO13849-1 Performance Level D
- High-response frequency of 2 kHz
- High resolution serial encoder for greater accuracy provided by 20 bits encoder
- · External encoder input for full close loop
- · Real time auto-tuning
- Advanced tuning algorithms (Anti-vibration function, torque feedforward, disturbance observer)

Ratings

- 230 VAC Single-phase 100 W to 1.5 kW (8.59 Nm)
- 400 VAC three-phase 600 W to 5 kW (28.7 Nm)



System configuration

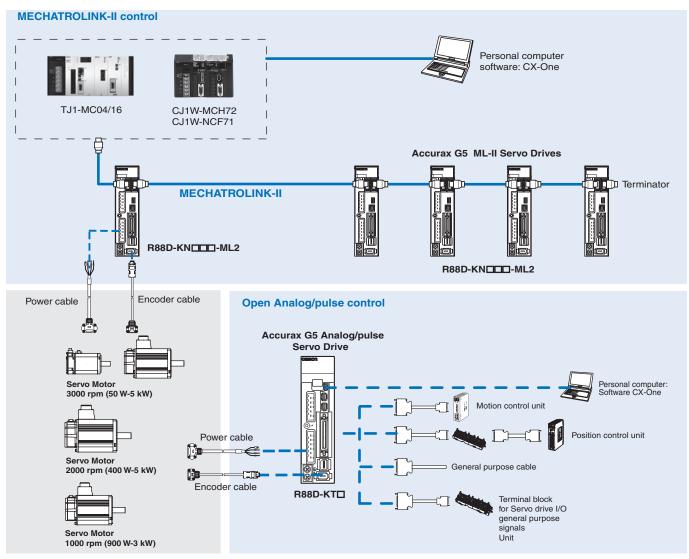

Servo motor supported

		Accurax	G5 rotary serv	o motor	Accurax G5 servodrive				
	Voltage	Speed	Rated torque	Capacity	Model	MECHATROLINK-II	model	Analog/Pulse	model
						230V	400V	230V	400V
	230 V	3000 min ⁻¹	0.16 Nm	50 W	R88M-K05030(H/T)-	R88D-KN01H-ML2	-	R88D-KT01H	-
			0.32 Nm	100 W	R88M-K10030(H/T)-	R88D-KN01H-ML2	-	R88D-KT01H	-
			0.64 Nm	200 W	R88M-K20030(H/T)-	R88D-KN02H-ML2	-	R88D-KT02H	-
			1.3 Nm	400 W	R88M-K40030(H/T)-	R88D-KN04H-ML2	-	R88D-KT04H	-
			2.4 Nm	750 W	R88M-K75030(H/T)-	R88D-KN08H-ML2	-	R88D-KT08H	-
			3.18 Nm	1000 W	R88M-K1K030(H/T)-	R88D-KN15H-ML2	-	R88D-KT15H	-
			4.77 Nm	1500 W	R88M-K1K530(H/T)-	R88D-KN15H-ML2	-	R88D-KT15H	-
	400 V		2.39 Nm	750 W	R88M-K75030(F/C)-	-	R88D-KN10F-ML2	-	R88D-KT10F
			3.18 Nm	1000 W	R88M-K1K030(F/C)-□	-	R88D-KN15F-ML2	-	R88D-KT15F
			4.77 Nm	1500 W	R88M-K1K530(F/C)-□	-	R88D-KN15F-ML2	-	R88D-KT15F
			6.37 Nm	2000 W	R88M-K2K030(F/C)-□	-	R88D-KN20F-ML2	-	R88D-KT20F
			9.55 Nm	3000 W	R88M-K3K030(F/C)-□	-	R88D-KN30F-ML2	-	R88D-KT30F
0			12.7 Nm	4000 W	R88M-K4K030(F/C)-	-	R88D-KN50F-ML2	-	R88D-KT50F
-	1		15.9 Nm	5000 W	R88M-K5K030(F/C)-□	-	R88D-KN50F-ML2	-	R88D-KT50F
	230 V	2000 min ⁻¹	4.77 Nm	1000 W	R88M-K1K020(H/T)-□	R88D-KN10H-ML2		R88D-KT10H	-
40			7.16 Nm	1500 W	R88M-K1K520(H/T)-	R88D-KN15H-ML2	-	R88D-KT15H	-
	400 V	1	1.91 Nm	400 W	R88M-K40020(F/C)-	-	R88D-KN06F-ML2	-	R88D-KT06F
			2.86 Nm	600 W	R88M-K60020(F/C)-	-	R88D-KN06F-ML2	-	R88D-KT06F
			4.77 Nm	1000 W	R88M-K1K020(F/C)-□	-	R88D-KN10F-ML2	-	R88D-KT10F
			7.16 Nm	1500 W	R88M-K1K520(F/C)-□	-	R88D-KN15F-ML2	-	R88D-KT15F
			9.55 Nm	2000 W	R88M-K2K020(F/C)-□	-	R88D-KN20F-ML2	-	R88D-KT20F
			14.3 Nm	3000 W	R88M-K3K020(F/C)-□	-	R88D-KN30F-ML2	-	R88D-KT30F
			19.1 Nm	4000 W	R88M-K4K020(F/C)-□	-	R88D-KN50F-ML2	-	R88D-KT50F
			23.9 Nm	5000 W	R88M-K5K020(F/C)-□	-	R88D-KN50F-ML2	-	R88D-KT50F
	230 V	1000 min ⁻¹	8.59 Nm	900 W	R88M-K90010(H/T)-	R88D-KN15H-ML2	-	R88D-KT15H	-
0	400 V		8.59 Nm	900 W	R88M-K90010(F/C)-		R88D-KN15F-ML2	-	R88D-KT15F
			19.1 Nm	2000 W	R88M-K2K010(F/C)-		R88D-KN30F-ML2	-	R88D-KT30F
			28.7 Nm	3000 W	R88M-K3K010(F/C)-		R88D-KN50F-ML2	-	R88D-KT50F

Type designation

Servo drive

R88D-KN01H-ML2 Model Accurax G5 Series servo drive -Blank: Analog/pulse type ML2: MECHATROLINK-II comms Drive Type Capacity and Voltage T: Analog/pulse type Voltage Code Output N: Network type 01H 100 W 02H 200 W 04H 400 W 230 V 750 W 08H 10H 1 kW 15H 1.5 kW 06F 600 W 1.0 kW 10F

AC servo systems

1.5 kW

2.0 kW

3.0 kW

5.0 kW

15F

20F 30F

50F

400 V

Servo drive specifications

Single-phase, 230 V

Se	rvo	drive type	R88D-K□	01H□	02H□	04H□	08H□	10H□	15H□		
Αp	Applicable R88M-K□		05030(H/T)□	20030(H/T)□	40030(H/T)□	75030(H/T)□	1K020(H/T)□	1K030(H/T)□			
se	rvo	motor		10030(H/T)□	-	-	-	-	1K530(H/T)□		
				-	-	-	-	-	1K520(H/T)□		
				-	-	-	-	-	90010(H/T)□		
	Ma	x. applicable motor cap	acity W	100	200	400	750	1000	1500		
	Со	ntinuous output current	Arms	1.2	1.6	2.6	4.1	5.9	9.4		
"	Inp	out power	Main circuit	Single-phase/3-pha	Single-phase/3-phase, 200 to 240 VAC + 10 to -15% (50/60 Hz)						
ecifications	Su	pply	Control circuit	Single-phase, 200 to 240 VAC + 10 to -15% (50/60 Hz)							
ati	Со	ntrol method		IGBT-driven PWM method, sinusoidal drive							
cific	Fe	edback		Serial encoder (incremental/absolute value)							
sbe	ns	Usage/storage temper	ature	0 to +55°C / -20 to 65°C							
S S	iţi	Usage/storage humidit	У	90% RH or less (non-condensing)							
Basic	Usage/storage temperature Usage/storage humidity Altitude Vibration/shock resistance (max)		1000m or less above sea level								
	Ö Vibration/shock resistance (max.)		5.88 m/s ² 10-60 Hz (Continuous operation at resonance point is not allowed) / 19.6 m/s ²								
	Configuration			Base mounted							
	Аp	prox. weight	Kg	0	.8	1.1	1.6	1.	8		

Three-phase, 400 V

Se	rvo	drive type	R88D-K□	06F-□	10F-□	15F-□	20F-□	30F-□	50F-□	
Ар	plic	able	R88M-K□	40020(F/C)-□	75030(F/C)-□	1K030(F/C)-□	2K030(F/C)-□	3K030(F/C)-□	4K030(F/C)-□	
se	rvo	motor		60020(F/C)-□	1K020(F/C)-□	1K530(F/C)-□	2K020(F/C)-□	3K020(F/C)-□	5K030(F/C)-□	
				-	-	1K520(F/C)-□	=	2K010(F/C)-□	4K020(F/C)-□	
				-	-	90010(F/C)-□	-	-	5K020(F/C)-□	
				-	-	-	-	-	3K010(F/C)-□	
	Ma	ax. applicable motor capa	acity kW	0.6	1.0	1.5	2.0	3.0	5.0	
	Со	entinuous output current	Arms	2.9 4.7			6.7	9.4	16.5	
	Inp	Input power Main circuit		3-phase, 380 to 480 VAC + 10 to -15% (50/60Hz)						
cifications	Su	ipply	Control circuit	24 VDC ±15%						
ati	Со	ontrol method		IGBT-driven PWM method, sinusoidal drive						
oific	Fe	edback		Serial encoder (incremental/absolute value)						
sbe	SL	Usage/storage tempera	ture	0 to +55°C / -20 to +65°C						
0	tior	Usage/storage humidity	/	90% RH or less (non-condensing)						
Basic	Usage/storage temperature Usage/storage humidity Altitude			1000 m or less above sea level						
	Vibration/shock resistance		5.88 m/s ² 10-60 Hz (Continuous operation at resonance point is not allowed) / 19.6 m/s ²							
	Configuration			Base mounted						
	Ap	prox. weight	Kg		1.9		2.7	4	.7	

General specifications (for MECHATROLINK-II servo drives)


Control mode			Position control, velocity control, torque control, full-closed control.			
Pe	erformance	Frequency characteristics	2 kHz			
		Speed zero clamp	Preset velocity command can be clamped to zero by the speed zero clamp input.			
		soft start time setting	0 to 10 s (acceleration, deceleration can be set separately).			
C	ommand input	MECHATROLINK-II communication	MECHATROLINK-II commands (for sequence, motion, data setting/reference, monitor, adjustment and other commands)			
jnal	Sequence input sig	nal	- Multi-function input x 8 by parameter setting (forward/reverse drive prohibition, emergency stop, external latch, origin proximity, forward/reverse torque limit, general purpose monitor input).			
I/O sig	Sequence output si	gnal	It is possible to output three types of signal form incl.: brake release, servo ready, servo alarm, positioning complete, motor rotation speed detection, torque limit detection, zero speed detection, speed coincidence detection, warning, position command status, speed limit detection, alarm ouput, speed command status.			
	USB	Interface	Personal computer/ Connector mini-USB			
	communications	Communications standard	Compliant with USB 2.0 standard			
		Function	Parameter setting and status monitoring			
		Communications protocol	MECHATROLINK-II			
	II communications	Station address	41H to 51 FH (max. number of slaves: 30)			
		Tranmission speed	10 Mbps			
		Transmission cycle	1, 2 & 4 ms			
		Data length	32 bytes			
	Automatic load inertia detection		Automatic motor parameter setting. One parameter rigidity setting.			
ns	Dynamic brake (DB)		Built-in. Operates during main power OFF, servo alarm, servo OFF or overtravel.			
뜑	Regenerative proce	ssing	Internal resistor included in models from 600 W to 5 kW. Regenerative resistor externally mounted (option).			
ŭ	Overtravel (OT) pre	vention function	DB stop, deceleration stop or coast to stop during P-OT, N-OT operation			
ţ.	Encoder divider fun	ction	Optional division possible			
te	Protective functions	;	Overcurrent, overvoltage, undervoltage, overspeed, overload, encoder error, overheat			
Integra	Analog monitor fund	ctions for supervision	Analog monitor of motor speed, speed reference, torque reference, command following error, analog input The monitoring signals to output and their scaling can be specified with parameters. Number of channels: 2 (Output voltage: ±10V DC)			
	Panel operator	Display functions	2-digit 7-segment LED display shows the drive status, alarm codes, parameters			
			MECHATROLINK-II communications status LED indicator (COM)			
		Switches	2 x rotary switches for setting the MECHATROLINK-II node address			
	CHARGE lamp		Lits when the main circuit power supply is turned ON.			
	Safety terminal	Functions	Safety Torque OFF function to cut off the motor current and stop the motor. Output signal for failure monitoring function.			
		Conformed standards	EN ISO13849-1:2008 (PL- d, Performance Level d), IEC61800-5 -2:2007 (function STO, Safe Torque OFF), EN61508:2001 (Safety Integrity Level 2, SIL2), EN954-1:1996 (CAT3).			
	External encoder fe	edback	Serial signal and line-driver A-B-Z encoder for full-close control			

General specifications (for analog/pulse servo drives)

Co	ontr	ol mode		7 modes selectables by parameter: (1) position control, (2) velocity control, (3) torque control, (4) position/velocity control, (5) position/torque control, (6) velocity/torque control and (7) full-closed control.			
-	Per	Performance Frequency characteristics		2 kHz			
ıtr			Speed zero clamp	Preset velocity command can be clamped to zero by the speed zero clamp input.			
8			Soft start time setting	0 to 10 s (acceleration, deceleration can be set separately). S-curve acceleration/deceleration is also available.			
ne	=	Speed control	Speed reference voltage	6 VDC at rated speed: set at delivery (the scale and polarity can be set by parameters)			
orq	gus	•	Torque limit	3 VDC at rated torque (torque can be limited separately in positive/negative direction).			
d/tc	si		Preset speed control	Preset speed is selectable from 8 internal settings by digital inputs.			
Speed/torque control	Input signal	Torque control	Torque reference voltage	3 VDC at rated torque: set at delivery (the scale and polarity can be set by parameters).			
S	므		Speed limit	Speed limit can be set by parameter.			
Į,		Command	Input pulse type	Sign + pulse train, 90° phase displacement 2-phase pulse (A-phase+ B-phase) or CCW/CW pulse train			
ī	nal	pulse	Input pulse frequency	4 Mpps max. (200 Kpps max. at open collector).			
Position control	Input signal		Command pulse scaling (Electronic Gear)	Applicable scaling ratio: 1/1000 - 1000 Any value of 1-2 ³⁰ can be set for numerator (encoder resolution) and denominator (command pulse resolution per motor revolution). The combination has to be within the range shown above.			
_	al	Command	Input pulse type	Sign + pulse train, 90° phase displacement 2-phase pulse (A-phase+ B-phase) or CCW/CW pulse train			
ntro	ign	pulse	Input pulse frequency	4 Mpps max. (200 Kpps max. at open collector).			
Full-closed control	Input signal		Command pulse scaling (Electronic Gear)	Applicable scaling ratio: 1/1000 - 1000 Any value of 1-2 ³⁰ can be set for numerator (encoder resolution) and denominator (command pulse resolution). The combination has to be within the range shown above.			
Full-clo	External encoder scaling		caling	Applicable scaling ratio: 1/20 - 160 Any value of 1-2 ³⁰ can be set for numerator (encoder resolution) and denominator (external encoder resolution per motor revolution). The combination has to be within the range shown above.			
	Pos	sition signal outp	out	A-phase, B.phase, Z-phase line driver output and Z-phase open-collector output.			
signal	Sequence input signal		equence input signal - Multi-function input x 10 by parameter setting (servo ON, control mode switching, forward/reverse drive bition, vibration filter switching, gain switching, electronic gear switching, error counter reset, pulse prohi alarm reset, internal speed selection, torque limit switching, zero speed, emergency stop, inertia ratio sw velocity/torque command sign).				
2				- Dedicated input x 1 (SEN: sensor ON, ABS data request).			
	Sequence output signal			It is possible to output four types of signal form incl.: brake release, servo ready, servo alarm, positioning complete, motor rotation speed detection, torque limit detection, zero speed detection, speed coincidence detection, warning, position command status, speed limit detection, speed command status.			

	USB	Interface	Personal computer/ Connector mini-USB			
	Communications	Communications standard	Compliant with USB 2.0 standard			
		Function	Parameter setting and status monitoring			
	Automatic load ine	ertia detection	Automatic motor parameter setting. One parameter rigidity setting.			
	Dynamic brake (D	B)	Built-in. Operates during main power OFF, servo alarm, servo OFF or overtravel.			
	Regenerative prod	essing	Internal resistor included in models from 600 W to 5 kW. Regenerative resistor externally mounted (option).			
	Overtravel (OT) pr	evention function	DB stop, deceleration stop or coast to stop during P-OT, N-OT operation			
2	Encoder divider fu	nction	Optional division possible			
functions	Electronic gearing	(Numerator/Denominator)	Up to 4 electronic gear numerators by combining with inputs.			
걸	Internal speed set	ting function	8 speeds may be set internally			
<u>1</u>	Protective function	IS	Overcurrent, overvoltage, undervoltage, overspeed, overload, encoder error, overheat			
ntegrated	Analog monitor functions for supervision		Analog monitor of motor speed, speed reference, torque reference, command following error, analog input The monitoring signals to output and their scaling can be specified by parameters. Number of channels: 2 (Output voltage: ±10V DC)			
ĭ	Panel operator	Display functions	6-digit 7-segment LED display shows the drive status, alarm codes, parameters			
		Panel operator keys	Used to set/monitor parameters and drive condition (5 key switches).			
	CHARGE lamp	•	Lits when the main circuit power supply is turned ON.			
	Safety terminal	Functions	Safety torque OFF function to cut off the motor current and stop the motor. Output signal for failure monitoring function.			
		Conformed standards	EN ISO13849-1:2008 (PL- d, Performance Level d), IEC61800-5 -2:2007 (function STO, Safe Torque OFF), EN61508:2001 (Safety Integrity Level 2, SIL2), EN954-1:1996 (CAT3).			
	External encoder f	eedback	Serial signal and line-driver A-B-Z encoder for full-close control			
	Expansion connec	tor	Serial bus for option board			

Servo drive part names

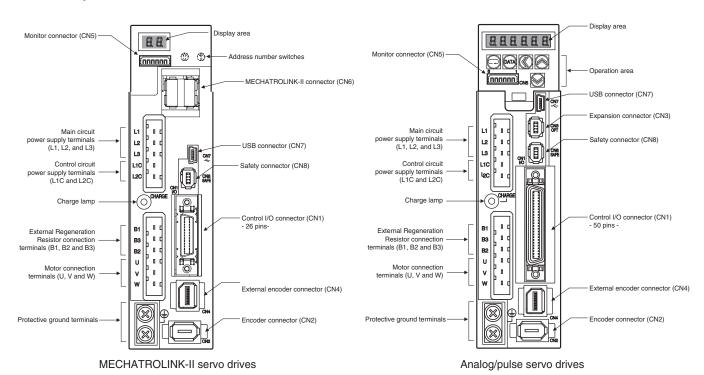

Note: the above pictures show 230 V servo drives models only. The 400 V servo drives have 24 VDC power input terminals for control circuit instead of L1C and L2C terminals.



I/O specifications

Terminals specifications (for all drives)

Symbol	Name	Function
L1	Main power supply input terminal	AC power input terminals for the main circuit
L2		
L3		Note: for single-phase servo drives connect the power supply input to L1 and L3.
L1C		AC power input terminals for the control circuit
L2C		(for 200V single/three-phase servo drives only).
24 V		DC power input terminals for the control circuit
0 V		(for 400V three-phase servo drives only).
B1		Servo drives below 750W: no internal resistor is connected. Leave B2 and B3 open.
B2		Connect an external regenerative resistor between B1 and B2.
B3		Servo drives from 750W to 5 kW: short-circuit in B2 and B3 for internal regenerative resistor. If the internal regenerative resistor is insufficient, connect an external regenerative resistor between B1 and B2 and remove the wire between B2 and B3.
U	Servo motor connection terminals	Terminals for outputs to the servomotor.
V		
W		

I/O signals (CN1) - Input signals (for MECHATROLINK-II servo drives)

Pin No.	Signal name	Function			
6	I-COM	± pole of external DC power. The	power must use 12V-24V (±5%)		
5	E-STOP	Emergency stop	The signal name shows the factory setting. The function can be		
7	P-OT	Forward run prohibited	changed by parameter setting.		
8	N-OT	Reverse run prohibited			
9	DEC	Origin proximity			
10	EXT3	External latch input 3			
11	EXT2	External latch input 2			
12	EXT1	External latch input 1			
13	SI-MON0	General purpose monitor input 0			
14	BTP-I	Connecting pin for the absolute en	coder backup battery. Do not connect when a battery is connected to the encoder cable (CN2		
15	BTN-I	connector).			
17	-	Terminals not used. Do not connect	ct.		
18	-				
19	-				
20	-				
21	-				
22	-				
23	-				
24	-				
-	PCL	Forward torque limit	The function of input signals allocated to pins 5 and 7 to 13 can be changed with these options by		
	NCL	Reverse torque limit	parameters settings.		
	SI-MON1	General-purpose monitor input 1			
	SI-MON2	General-purpose monitor input 2			
Shell	FG	Shield ground. Connected to frame	e ground if the shield wire of the I/O signal cable is connected to the connector shell.		
16	GND	Signal ground. It is insulated with p	power supply (I-COM) for the control signal in the servo drive.		

I/O signals (CN1) - output signals (for MECHATROLINK-II servo drives)

Pin No.	Signal name	Function	
1	BRK-OFF+	External brake release signal	
2	BRK-OFF		
25	S-RDY+	Servo ready: ON when there is	s no servo alarm and control/main circuit power supply is ON
26	S-RDY-		
3	ALM+	Servo alarm: Turns OFF when	an error is detected
4	ALM-		
-	INP1	Position complete output 1	The function of output signals allocated to pins 1,2, 25 and 26 can be changed with these options by
	AT-SPEED	Speed complete	parameters settings
	T_LIM	Torque limit	
	ZSP	Zero speed	
	V-COIN	Speed coincidence	
	INP2	Position complete output 2	
	WARN1	Warning 1	
	WARN2	Warning 2	
	DEN	Origin proximity	
	V_LIM	Speed limit]

I/O signals (CN1) - Input signals (for analog/pulse servo drives)

Pin No.	Control mode	Signal name	Function	
1	Position/	+24 VCW	Reference pulse input for line dr	ver and open collector according to parameter setting.
3	Full close loop	+CW		
4		-CW	Input mode:	
2		+24 VCW	Sign + pulse string Reverse/forward pulse (CCW/C)	M pulso)
5		+CCW	Two-phase pulse (90° phase diff	
6		-CCW	Two phase paise (see phase and	oronial
44		+CWLD	Reference pulse input for line dr	ver only.
45		-CWLD	1	,
46		+CCWLD	Input mode:	
47		-CCWLD	Reverse/forward pulse (CCW/C)	V pulse)
14	Speed	REF	Speed reference input: ±10 V/ra	ted motor speed (input gain can be modified using a parameter).
	Torque	TREF1		ted motor torque (input gain can be modified using a parameter).
		VLIM		otor speed (input gain can be modified using a parameter).
15	_	AGND1	Analog signal ground	otor opeou (input gain out so mounted doing a paramotor).
16	Torque	TREF2		ted motor torque (input gain can be modified using a parameter).
10	Position/Speed			//rated motor torque (input gain can be modified using a parameter).
18	Full close loop	NCL		//rated motor torque (input gain can be modified using a parameter).
17	-	AGND1	Analog signal ground	, and a motor torque (input gain our se meanied doing a parameter).
7	Common	+24 VIN		equence signals: users must provide the +24 V power supply (12 to 24 V).
29	Common	RUN	Servo ON: this turn ON the serve	
26	Position/Full	DFSEL1	Vibration filter switching 1	Enables vibration filter according parameter setting.
20	close loop	DI SELI	Vibration litter switching i	Enables visitation litter according parameter setting.
27	Common	GSEL	Gain switching	Enables gain value according parameter setting.
28	Position/Full	GESEL1	Electronic gear switching 1	Switches the numerator fro electronic gear ratio.
20	close loop	GEOLE!	Licenterine godi ewiterining i	Children and numerator no dissilicino goal ratio.
	Speed	VSEL3	Internal speed selection 3	Input to select the desired speed setting during internally speed operation.
				The speed selecton is combining this input with VSEL1 and VSEL2 inputs.
30	Position/Full	ECRST	Error counter reset input.	Resets the position error counter.
	close loop		-	·
	Speed	VSEL2	Internal speed selection 2	Input to select the desired speed setting during internally speed operation.
				The speed selecton is combining this input with VSEL1 and VSEL3 inputs.
31	Common	RESET	Alarm reset input.	Release the alarm status. The error counter is reset when the alarm is reset.
32	Position/	TVSEL	Control mode switching	Position ↔ speed)
	Speed/Torque			·
				Position ↔ torque
				Torque ↔ speed
				Torque (+) speed
33	Position	IPG		put to inhibit the position reference pulse.
	Speed	VSEL1	Internal speed selection 1	Input to select the desired speed setting during internally speed operation.
	_			The speed selecton is combining this input with VSEL2 and VSEL3 inputs.
8	Coomon	NOT	Reverse run prohibited	Overtravel prohibited: stops servomotor when movable part travels beyond the
9		POT	Forward run prohibited	allowable range of motion.
20	Position/	SEN	·	uest signal when using an absolute encoder.
13	Speed/Torque	SENGND	Sensor ON signal ground.	
42	Common	BAT (+)		hals when the absolute encoder power is interrupted. Do not connect when a absolute
43	_	BATGND (-)	encoder battery cable for backup	o is used.
50		FG	Frame ground	
-	-	TLSEL	Torque limit switch	The function of input signals allocated to pins 8,9 and 26 to 33 can be changed with
		DFSEL2	Vibration filter switching 2	these options by parameters settings
		GESEL2	Electronic gear switching 2	
		VZERO	Zero speed	
		VSIGN	Speed command signal	
		TSIGN	Torque command signal	
		E-STOP	Emergency stop	
		JSEL	Inertia ratio switching	
12	-	Terminals not u	used. Do not connect.	
40	-	1		
41	-			

I/O signals (CN1) - output signals (for analog/pulse servo drives)

Pin No.	Control mode	Signal name	Function			
21	Position/	+A	Encoder phase A+	Encoder signals (or external scale signals during full closing control) are output according En-		
22	Full close loop	-A	Encoder phase A-	coder Dividing Numerator parameter.		
48		+B	Encoder phase B+	This is the line-driver output (equivalent to R422). The maximum output frequency is 4 Mbps. Phase Z is output for encoder signals (or external scale signals during full closing control). This		
49		-В	Encoder phase B-	is the line-driver output (equivalent to R422).		
23		+Z	Encoder phase Z+	is the line driver output (equivalent to 11-122).		
24		-Z	Encoder phase Z-			
19		Z	Encoder phase-Z output	Phase Z is output for encoder signals (or external scale signals during full closing control).		
25		ZCOM	Encoder phase-Z common	Open-collector output.		
11	Common	BKIR	Brake release signal output	Timing signal for operating the electromagnetic brake on a motor.		
10		BKIRCOM				
35		READY	Servo ready: ON if there is not servo alarm when the control/main circuit power supply is turned ON.			
34		READYCOM				
37		/ALM	Servo alarm: turns OFF whe	en an error is detected.		
36		ALMCOM				
39	Speed/torque	TGON	Motor rotation speed detection	on. This output turns ON when the motor rotation speed reaches the speed set in a parameter.		
39	Position/	INP1	Positioning complete output	1: turns ON when position error is equal to setting parameter.		
38	Full close loop	INP1COM				
-	-	INP2	Position complete output 2	The function of output signals allocated to pins 11,10, 34 to 39 can be changed with these op-		
		P-CMD	Position command status	tions by parameters settings.		
		ZSP	Zero speed			
		WARN1	Warning 1			
		WARN2	Warning 2			
		ALM-ATB	Alarm output			
		VCMP	Speed conformity output			
		V-CMD	Speed command status			
		V-LIMIT	Speed limit detection			
		T-LIMIT	Torque limit detection			

Encoder connector (CN2) - (for all servo drives)

Pin No.	Signal name Function	
1	E5V	Encoder power supply + 5 V
2	E0V	Encoder power supply ground
3	BAT+ Battery + (used only with absolute encoder)	
4	BAT- Battery – (used only with absolute encoder)	
5	PS+ Encoder serial signal input (+phase)	
6	PS- Encoder serial signal input (-phase)	
Shell	FG	Shield ground

External encoder connector (CN4) - (for all servo drives)

Pin No.	Signal name	Function		
1	E5V	External scale power supply output. Use at 5.2V +/-5% and at or below 250 mA.		
2	E0V	This is connected to the control circuit ground connected to connector CN1.		
3	PS	External scale signal I/O (serial signal).		
4	/PS			
5	EXA	External scale signal input (Phase A, B, and Z signals). Perfoms the input and output of phase A, B and Z signals.		
6	/EXA			
7	EXB			
8	/EXB			
9	EXZ			
10	/EXZ			
Shell	FG	Shield ground		

Monitor connector (CN5) - (for all servo drives)

Pin No.	Signal name	Function	
1		Analog monitor output 1. Outputs the analog signal for the monitor. Use the parameters setting to select the output to monitor. Default setting: Motor rotation speed 1 V/(1000 r/min).	
2		Analog monitor output 2. Outputs the analog signal for the monitor. Use the parameters setting to select the output to monitor. Default setting: Motor rotation speed 1 V/(1000 r/min).	
3	GND	Ground for analog monitors 1,2.	
4	-	Terminals not used. Do not connect.	
5	-		
6	-		

USB connector (CN7) - (all servo drives)

Pin No.	Signal name	Function
1	VBUS	USB signal terminal for computer comunication.
2	D-	
3	D+	Ground for analog monitors 1,2.
4	-	Not used. Do not connect.
5	GND	Signal ground.


Safety connector (CN8) - (all servo drives)


Pin No.	Signal name	Function
1	-	Not used. Do not connect.
2	-	
3	SF1-	Safety input 1 & 2. This input turns OFF the power trransistor drive signals in the servo drive to cut off the current
4	SF1+	output to the motor.
5	SF2-	
6	SF2+	
7	EDM-	A monitor signal is output to detect a safety function failure.
8	EDM+	
Shell	FG	Frame ground.

Dimensions


Servo drives


R88D-KT01/02H, R88D-KN01/02H-ML2 (230 V, 100 - 200 W)

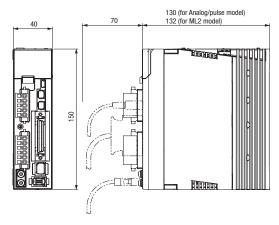

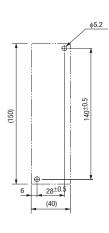


R88D-KT04H, R88D-KN04H-ML2 (230 V, 400 W)

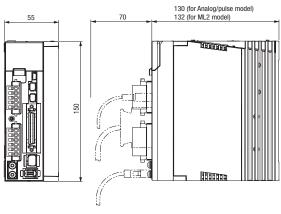


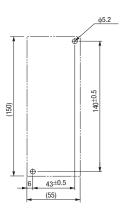


R88D-KT08H, R88D-KN08H-ML2 (230 V, 750 W)

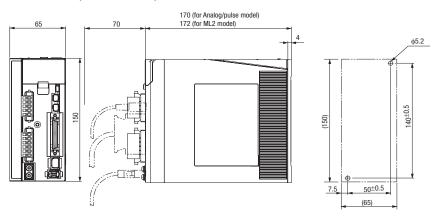


R88D-KT10/15H, R88D-KN10/15H-ML2 (230 V, 1 - 1.5 kW)

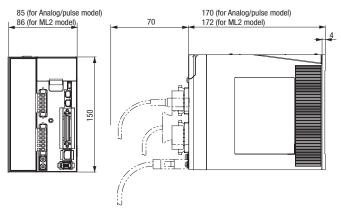


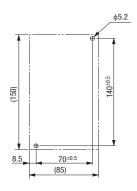


R88D-KT06/10/15F, R88D-KN06/10/15F-ML2 (400 V, 600 W - 1.5 kW)

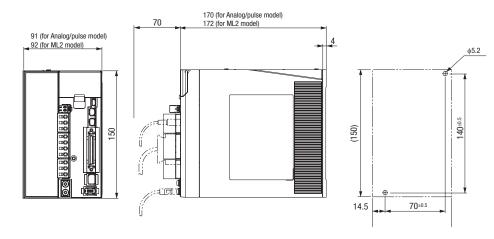

R88D-KT20F, R88D-KN20F-ML2 (400 V, 2 kW)

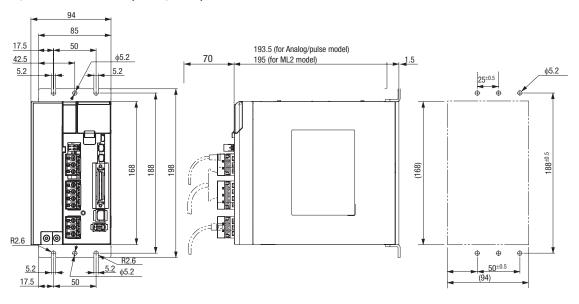


R88D-KT30/50F, R88D-KN30/50F-ML2 (400 V, 3 - 5 kW)

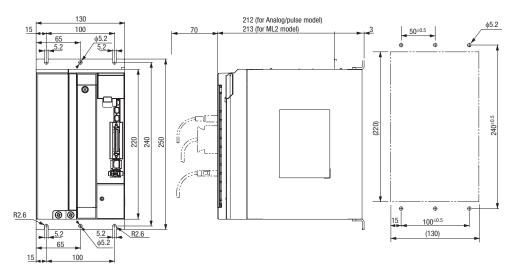


Filters

Filter model	External dimensions			Mount dimensions	
	Н	W	D	M1	M2
R88A-FIK102-RE	190	42	44	180	20
R88A-FIK104-RE	190	57	30	180	30
R88A-FIK107-RE	190	64	35	180	40
R88A-FIK114-RE	190	86	35	180	60
R88A-FIK304-RE	190	86	40	180	60
R88A-FIK306-RE	245	94	40	235	60
R88A-FIK312-RE	290	130	45	280	100

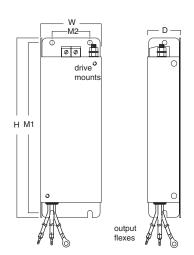

Installation

Single-phase, 230 VAC (for MECHATROLINK-II servo drives)

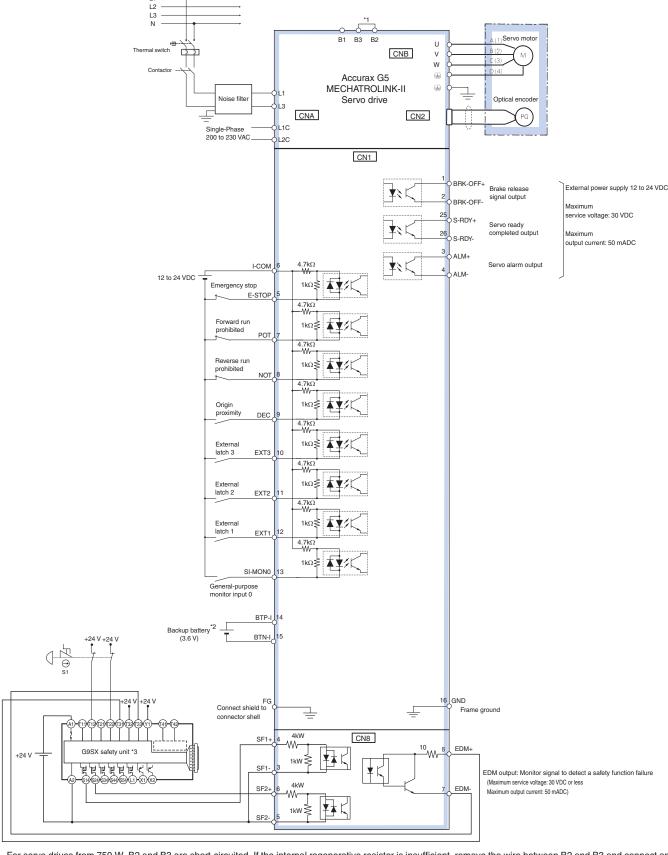


^{*1} For servo drives from 750 W, B2 and B3 are short-circuited. If the internal regenerative resistor is insufficient, remove the wire between B2 and B3 and connect an external regenerative resistor between B1 and B2.

Note: The input function of pins 5 and 7 to 13, and output function of pins 1, 2, 25 and 26, can be changed via parameter settings.

^{*2} For use only with an absolute encoder. If a backup battery is connected to CN1 I/O connector, an encoder cable with a battery is not required.

^{*3} Wiring diagram example using the G9SX safety unit. If a safety unit is not used, keep the factory safety bypass connector installed in the CN8.

Three-phase, 400 VAC (for MECHATROLINK-II servo drives)

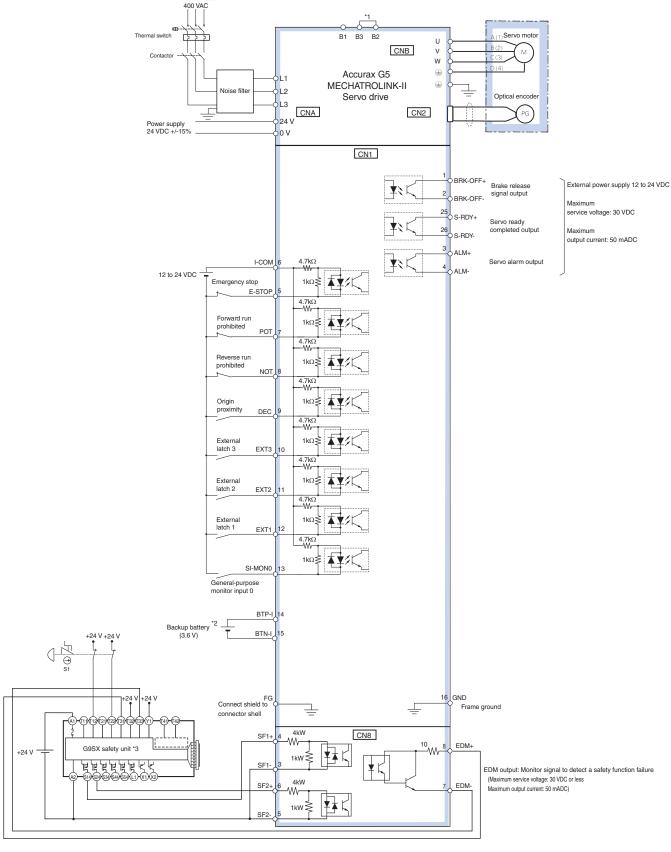


^{*1} Normally B2 and B3 are short-circuited. If the internal regenerative resistor is insufficient, remove the wire between B2 and B3 and connect an external regenerative resistor between B1 and B2.

Note: The input function of pins 5 and 7 to 13, and output function of pins 1, 2, 25 and 26, can be changed via parameter settings.

^{*2} For use only with an absolute encoder. If a backup battery is connected to CN1 I/O connector, an encoder cable with a battery is not required.

³ Wiring diagram example using the G9SX safety unit. If a safety unit is not used, keep the factory safety bypass connector installed in the CN8.

Single-phase, 230 VAC(for analog/pulse servo drives)

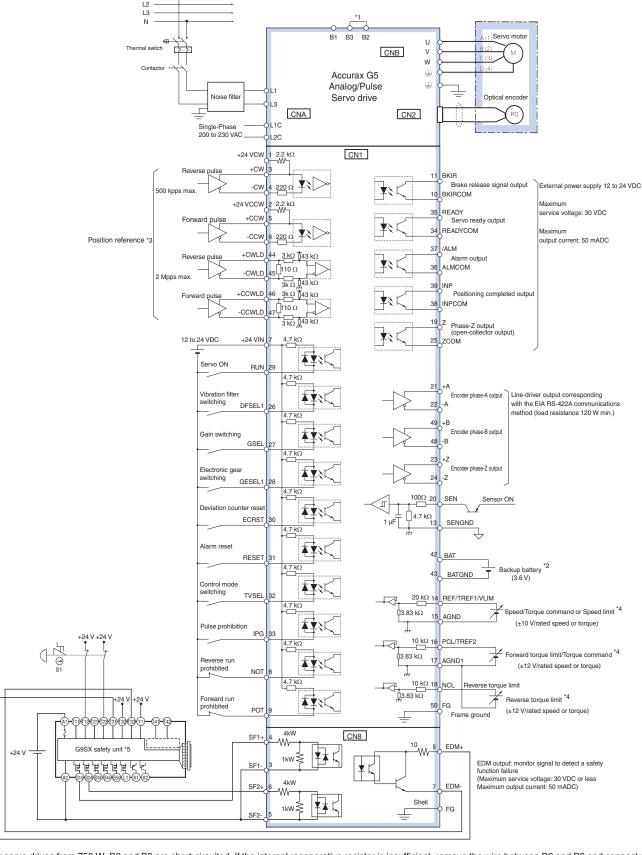

For servo drives from 750 W, B2 and B3 are short-circuited. If the internal regenerative resistor is insufficient, remove the wire between B2 and B3 and connect an external regenerative resistor between B1 and B2.

Note: The input function of pins 8,9 and 26 to 33, and output function of pins 10, 11, 34, 35, 38 and 39, can be changed via parameter settings.

For use only with an absolute encoder. If a backup battery is connected to CN1 I/O connector, an encoder cable with a battery is not required. Only available in Position control mode.


^{*3}

The input function depends on control mode used (Position, speed or torque control).

Wiring diagram example using the G9SX safety unit. If a safety unit is not used, keep the factory safety bypass connector installed in the CN8.

Three-phase, 400 VAC (for analog/pulse servo drives)

Three-Phase

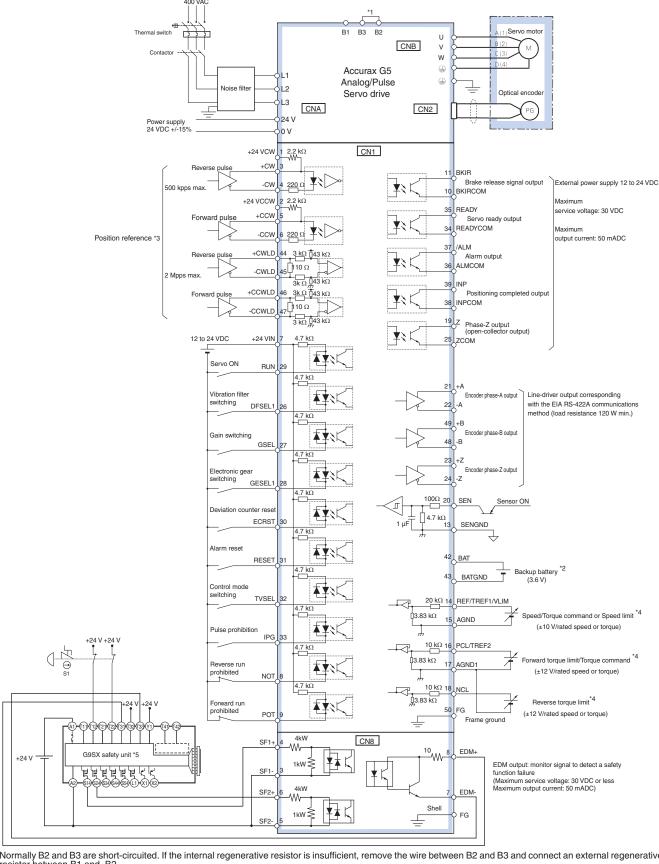



- Normally B2 and B3 are short-circuited. If the internal regenerative resistor is insufficient, remove the wire between B2 and B3 and connect an external regenerative resistor between B1 and B2.
- For use only with an absolute encoder. If a backup battery is connected to CN1 I/O connector, an encoder cable with a battery is not required.
- Only available in Position control mode.
- The input function depends on control mode used (Position, speed or torque control).
- Wiring diagram example using the G9SX safety unit. If a safety unit is not used, keep the factory safety bypass connector installed in the CN8.

Note: The input function of pins 8,9 and 26 to 33, and output function of pins 10, 11, 34, 35, 38 and 39, can be changed via parameter settings.

Ordering information

Accurax G5 series MECHATROLINK-II reference configuration

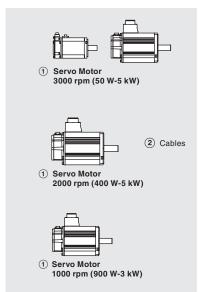

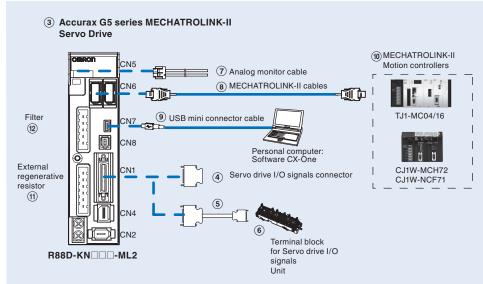

 $\textbf{Note:} \ \ \textbf{The symbols 1) 2) 3) 4) 5)... \ \ \textbf{show the recommended sequence to select the components in Accurax G5 servo system}$

Servo motors, power & encoder cables

Note: 1)(2) Refer to the Accurax G5 servo motor chapter for servomotor, motor cables or connectors selection

Servo drives

Symbol	Specifications		Servo drive model	Compatible G5 series rotary servo motors
(3)	1 phase 230 VAC	100 W	R88D-KN01H-ML2	R88M-K05030(H/T)-□
				R88M-K10030(H/T)-□
		200 W	R88D-KN02H-ML2	R88M-K20030(H/T)-□
		400 W	R88D-KN04H-ML2	R88M-K40030(H/T)-□
		750 W	R88D-KN08H-ML2	R88M-K75030(H/T)-□
		1.0 kW	R88D-KN10H-ML2	R88M-K1K020(H/T)-□
		1.5 kW	R88D-KN15H-ML2	R88M-K1K030(H/T)-□
				R88M-K1K530(H/T)-□
				R88M-K1K520(H/T)-□
				R88M-K90010(H/T)-□
	3 phase 400 VAC	600 W	R88D-KN06F-ML2	R88M-K40020(F/C)-□
	prided 100 Trio			R88M-K60020(F/C)-□
		1.0 kW	R88D-KN10F-ML2	R88M-K75030(F/C)-□
				R88M-K1K020(F/C)-□
		1.5 kW	R88D-KN15F-ML2	R88M-K1K030(F/C)-□
				R88M-K1K530(F/C)-□
				R88M-K1K520(F/C)-□
				R88M-K90010(F/C)-□
		2.0 kW	R88D-KN20F-ML2	R88M-K2K030(F/C)-□
				R88M-K2K020(F/C)-□
		3.0 kW	R88D-KN30F-ML2	R88M-K3K030(F/C)-□
				R88M-K3K020(F/C)-□
	5.0 kW R88D-KN50F-ML2	R88M-K2K010(F/C)-□		
		R88M-K4K030(F/C)-□		
				R88M-K5K030(F/C)-□
				R88M-K4K020(F/C)-□
				R88M-K5K020(F/C)-□
				R88M-K3K010(F/C)-□

Control cables (for CN1)

Symbol	Description	Connect to		Model
4)	I/O connector kit (26 pins)	For I/O general purpose	-	R88A-CNW01C
	General purpose cable		1 m	R88A-CPKB001S-E
(5)	Terminal block cable	For I/O general purpose	1 m	XW2Z-100J-B34
			2 m	XW2Z-200J-B34
6	Terminal block (M3 screw and for pin terminals)		-	XW2B-20G4
	Terminal block (M3.5 screw and for fork/round terminals)	1	-	XW2B-20G5
	Terminal block (M3 screw and for fork/round terminals)		-	XW2D-20G6

Analog monitor (for CN5)

Symbol	Name		Model
7	Analog monitor cable	1m	R88A-CMK001S

MECHATROLINK-II cables (for CN6)

Symbol	Specifications	Length	Model
8	MECHATROLINK-II Terminator resistor		JEPMC-W6022-E
	MECHATROLINK-II cables	0.5 m	JEPMC-W6003-A5-E
		1 m	JEPMC-W6003-01-E
		3 m	JEPMC-W6003-03-E
		5 m	JEPMC-W6003-05-E
		10 m	JEPMC-W6003-10-E
		20 m	JEPMC-W6003-20-E
		30 m	JEPMC-W6003-30-E

USB personal computer cable (for CN7)

Symbol	Name		Model
9	USB mini-connector cable	2m	AX-CUSBM002-E

MECHATROLINK-II Motion controllers

Symbol	Name	Model
10	Trajexia stand-alone motion controller	TJ1-MC04 (4 axes)
		TJ1-MC16 (16 axes)
	Trajexia-PLC motion controller	CJ1W-MCH72
	Position Controller Unit for CJ1 PLC	CJ1W-NCF71 (16 axes)
		CJ1W-NC471 (4 axes)
		CJ1W-NC271 (2 axes)
	Position Controller Unit for CS1 PLC	CS1W-NCF71 (16 axes)
		CS1W-NC471 (4 axes)
		CS1W-NC271 (2 axes)

External regenerative resistor

Symbol	Regenerative resistor unit model	Specifications
(1)	R88A-RR08050S	50 Ω, 80 W
	R88A-RR080100S	100 Ω, 80 W
	R88A-RR22047S	47 Ω, 220 W
	R88A-RR50020S	20 Ω, 500 W

Cable for Safety Functions (for CN8)

Symbol	Description	Model
-	Safety connector with 3 m cable (with loose wires at one end)	R88A-CSK003S-E

Filters

Symbol	Applicable servodrive	Filter model	Rated current	Leakage current	Rated voltage
12	R88D-KN01H-ML2, R88D-KN02H-ML2	R88A-FIK102-RE	2.4 A	3.5 mA	250 VAC single-phase
	R88D-KN04H-ML2	R88A-FIK104-RE	4.1 A	3.5 mA	
	R88D-KN08H-ML2	R88A-FIK107-RE	6.6 A	3.5 mA	
	R88D-KN10H-ML2, R88D-KN15H-ML2	R88A-FIK114-RE	14.2 A	3.5 mA	
	R88D-KN06F-ML2, R88D-KN10F-ML2, R88D-KN15F-ML2	R88A-FIK304-RE	4 A	0.3 mA / 32 mA ¹	400 VAC three-phase
	R88D-KN20F-ML2	R88A-FIK306-RE	6 A	0.3 mA / 32 mA ¹	
	R88D-KN30F-ML2, R88D-KN50F-ML2	R88A-FIK312-RE	12.1 A	0.3 mA / 32 mA ¹	

^{1.} Momentary peak leakage current for the filter at switch-on/off.

Connectors


Specifications	Model
External encoder connector (for CN4)	R88A-CNK41L
Safety I/O signal connector (for CN8)	R88A-CNK81S

Computer software

Specifications	Model
Configuration and monitoring software tool for servo drives and inverters. (CX-drive version 1.91 or higher)	CX-drive

Ordering information

Accurax G5 series Analog/pulse Reference configuration

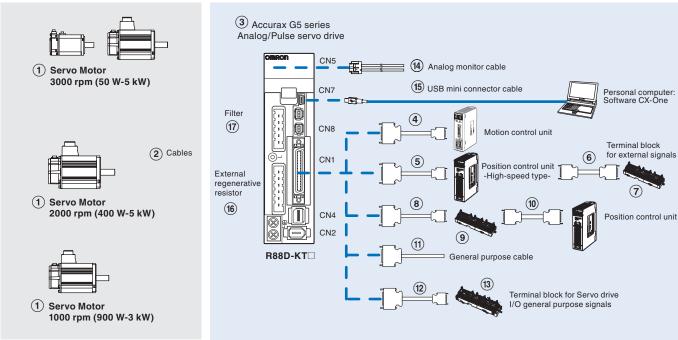

Note: The symbols (1234)s... show the recommended sequence to select the components in Accurax G5 servo system

Servo motors, power & encoder cables

Note: 1)2 Refer to the Accurax G5 servo motor chapter for servomotor, motor cables or connectors selection

Servo drives

Symbol	Specifications		Servo drive model	Compatible Accurax G5 series rotary servo motors
3	1 phase 230 VAC	100 W	R88D-KT01H	R88M-K05030(H/T)-□
				R88M-K10030(H/T)-□
3 1 ph		200 W	R88D-KT02H	R88M-K20030(H/T)-□
		400 W	R88D-KT04H	R88M-K40030(H/T)-□
		750 W	R88D-KT08H	R88M-K75030(H/T)-□
		1.0 kW	R88D-KT10H	R88M-K1K020(H/T)-□
		1.5 kW	R88D-KT15H	R88M-K1K030(H/T)-□
				R88M-K1K530(H/T)-□
				R88M-K1K520(H/T)-□
				R88M-K90010(H/T)-□
	3 phase 400 VAC	600 W	R88D-KT06F	R88M-K40020(F/C)-□
	P			R88M-K60020(F/C)-□
	1.0 kW R88D-KT10F R88M-K75030(F/	R88M-K75030(F/C)-□		
				R88M-K1K020(F/C)-□
		1.5 kW	R88D-KT15F	R88M-K1K030(F/C)-□
				R88M-K1K530(F/C)-□
				R88M-K1K520(F/C)-□
				R88M-K90010(F/C)-□
		2.0 kW	R88D-KT20F	R88M-K2K030(F/C)-□
				R88M-K2K020(F/C)-□
		3.0 kW	R88D-KT30F	R88M-K3K030(F/C)-□
				R88M-K3K020(F/C)-□
				R88M-K2K010(F/C)-□
		5.0 kW	R88D-KT50F	R88M-K4K030(F/C)-□
				R88M-K5K030(F/C)-□
				R88M-K4K020(F/C)-□
				R88M-K5K020(F/C)-□
				R88M-K3K010(F/C)-□

Control cables (for CN1)

Symbol	Description	Connect to		Model
(4)	Control cable	Motion control units	1 m	R88A-CPG001M1
4)	(1 axis)	CS1W-MC221	2 m	R88A-CPG002M1
	(1 43.05)	CS1W-MC421		R88A-CPG003M1
			3 m	
			5 m	R88A-CPG005M1
	Control cable	Motion control units	1 m	R88A-CPG001M2
	(2 axis)	CS1W-MC221 CS1W-MC421	2 m	R88A-CPG002M2
		CS1W-WC421	3 m	R88A-CPG003M2
			5 m	R88A-CPG005M2
(5)	Control cable	Position control units (high-speed type)	1 m	XW2Z-100J-G9
	(line-driver output for 1 axis)	CJ1W-NC234	5 m	XW2Z-500J-G9
		CJ1W-NC434	10 m	XW2Z-10MJ-G9
	Control cable	Position control units (high-speed type)	1 m	XW2Z-100J-G13
	(open-collector output for 1 axis)	CJ1W-NC214	3 m	XW2Z-300J-G13
	(open concotor carparter rang)	CJ1W-NC414	3 111	XW22-3000-G13
	Control cable	Position control units (high-speed type)	1 m	XW2Z-100J-G1
	(line-driver output for 2 axis)	CJ1W-NC234	5 m	XW2Z-500J-G1
	,	CJ1W-NC434	10 m	XW2Z-10MJ-G1
	Control cable	Desition control units (high around type)	1 m	XW2Z-10M5-G1 XW2Z-100J-G5
	(open-collector output for 2 axis)	Position control units (high-speed type) CJ1W-NC214		
	(open-collector output for 2 axis)	CJ1W-NC414	3 m	XW2Z-300J-G5
(6)	Terminal block cable for external signals	Position control units (high-speed type)	0.5 m	XW2Z-C50X
•	(for input common, forward/reverse run prohibited inputs,	CJ1W-NC234		
	emergency stop input, origin proximity input and interrupt in-	CJ1W-NC434	1 m	XW2Z-100X
	put)	CJ1W-NC214	2 m	XW2Z-200X
	puty	CJ1W-NC414	3 m	XW2Z-300X
			5 m	XW2Z-500X
			10 m	XW2Z-010X
(7)	Terminal block for external signals (M3 screw, pin terminals)		-	XW2B-20G4
_	Terminal block for ext. signals (M3.5 screw, fork/round terminals)		-	XW2B-20G5
	Terminal block for ext. signals (M3 screw, fork/round terminals)		_	XW2D-20G6
8	Cable from servo relay unit to servo drive	CS1W-NC1□3. CJ1W-NC1□3. C200HW-NC113.	1 m	XW2Z-100J-B25
•	Cable from servo relay unit to servo unive	CS1W-NC2\(\subseteq 3\), CJ1W-NC2\(\subseteq 3\), 4\(\subseteq 3\), CJ1W-NC2\(\subseteq 3\), 4\(\subseteq 3\),	2 m	XW2Z-1000-B25 XW2Z-200J-B25
		C200HW-NC213/413, CQM1H-PLB21 or CQM1-CPU43	2 111	XVV2Z-200J-B25
		CJ1M-CPU21/22/23	1 m	XW2Z-100J-B31
		OUTWO OF OZITZZIZO	2 m	XW2Z-200J-B31
	Com to volov unit	Position control units	2 111	
9	Servo relay unit	CS1W-NC1□3, CJ1W-NC1□3 or C200HW-NC113	-	XW2B-20J6-1B (1 axis)
		Position control units		XW2B-40J6-2B (2 axes)
		CS1W-NC2\(\text{3}\)4\(\text{3}\), CJ1W-NC2\(\text{3}\)4\(\text{3}\) or	-	AVV2B-4030-2B (2 axes)
		C200HW-NC213/413		
		CQM1H-PLB21 or CQM1-CPU43		XW2B-20J6-3B (1 axis)
		CJ1M-CPU21/22/23	-	XW2B-2006-8A (1 axis)
		CJ IW-CPU2 1/22/23	-	XW2B-2036-8A (1 axis) XW2B-40J6-9A (2 axes)
	Position control unit	ICQM1H-PLB21	0.5 m	XW2Z-050J-A3
10)	connecting cable	CQWITH-FLB21		
	Connecting capie		1 m	XW2Z-100J-A3
		CS1W-NC113 or C200HW-NC113		XW2Z-050J-A6
			1 m	XW2Z-100J-A6
		CS1W-NC213/413 or C200HW-NC213/413	0.5 m	XW2Z-050J-A7
			1 m	XW2Z-100J-A7
		CS1W-NC133	0.5 m	XW2Z-050J-A10
			1 m	XW2Z-100J-A10
		CS1W-NC233/433		XW2Z-050J-A11
				XW2Z-100J-A11
		CJ1W-NC113		XW2Z-050J-A14
		001W-N0113	1 m	XW2Z-0303-A14 XW2Z-100J-A14
		C HW NC212/412		
		CJ1W-NC213/413		XW2Z-050J-A15
		0.1111.110.100		XW2Z-100J-A15
		CJ1W-NC133		XW2Z-050J-A18
			1 m	XW2Z-100J-A18
		CJ1W-NC233/433	0.5 m	XW2Z-050J-A19
			1 m	XW2Z-100J-A19
		CJ1M-CPU21/22/23	0.5 m	XW2Z-050J-A33
			1 m	XW2Z-100J-A33
(11)	General purpose cable	For general purpose controllers	1 m	R88A-CPG001S
11)		i or general purpose controllers		R88A-CPG002S
40	Terminal block cable	For general purpose controllers		XW2Z-100J-B24
12	reminal block cable	or general purpose controllers	1 m	
(2)	T	-	2 m	XW2Z-200J-B24
(13)	Terminal block (M3 screw and for pin terminals)	1		XW2B-50G4
	Terminal block (M3.5 screw and for fork/round terminals)		1-	XW2B-50G5
	Terminal block (M3 screw and for fork/round terminals)	4		XW2D-50G6

Analog monitor (for CN5)

Symbol	Name		Model
14)	Analog monitor cable	1m	R88A-CMK001S

USB personal computer cable (for CN7)

Symbol	Name		Model
15)	USB mini-connector cable	2m	AX-CUSBM002-E

External regenerative resistor

Symbol	Regenerative resistor unit model	Specifications
16)	R88A-RR08050S	50 Ω, 80 W
	R88A-RR080100S	100 Ω, 80 W
	R88A-RR22047S	47 Ω, 220 W
	R88A-RR50020S	20 Ω, 500 W

Cable for Safety Functions (for CN8)

Symbol	Description	Model
	Safety connector with 3 m cable	R88A-CSK003S-E
	(with loose wires at one end)	

Filters

Symbol	Applicable servodrive	Filter model	Rated current	Leakage current	Rated voltage
17	R88D-KT01H, R88D-KT02H	R88A-FIK102-RE	2.4 A	3.5 mA	250 VAC single-phase
	R88D-KT04H	R88A-FIK104-RE	4.1 A	3.5 mA	
	R88D-KT08H	R88A-FIK107-RE	6.6 A	3.5 mA	
	R88D-KT10H, R88D-KT15H	R88A-FIK114-RE	14.2 A	3.5 mA	
	R88D-KT06F, R88D-KT10F, R88D-KT15F	R88A-FIK304-RE	4 A	0.3 mA / 32 mA ¹	400 VAC three-phase
	R88D-KT20F	R88A-FIK306-RE	6 A	0.3 mA / 32 mA ¹	
	R88D-KT30F, R88D-KT50F	R88A-FIK312-RE	12.1 A	0.3 mA / 32 mA ¹	

^{1.} Momentary peak leakage current for the filter at switch-on/off.

Connectors

Specifications	Model
I/O connector kit -50 pins-(for CN1)	R88A-CNU11C
External encoder connector (for CN4)	R88A-CNK41L
Safety I/O signal connector (for CN8)	R88A-CNK81S

Computer software

Specifications	Model
Configuration and monitoring software tool for servo drives and inverters. (CX-drive version 1.90 or higher)	CX-drive

ALL DIMENSIONS SHOWN ARE IN MILLIMETERS.

 $To \ convert \ millimeters \ into \ inches, \ multiply \ by \ 0.03937. \ To \ convert \ grams \ into \ ounces, \ multiply \ by \ 0.03527.$

Cat. No. I101E-EN-01A

In the interest of product improvement, specifications are subject to change without notice.